
High Level Sewershed

Run Summary ————————————————————————————————————								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-009	Smoke	8/7/2008	ADS/TM	S09AA1003MH	Dry	Yes	2,090.72	

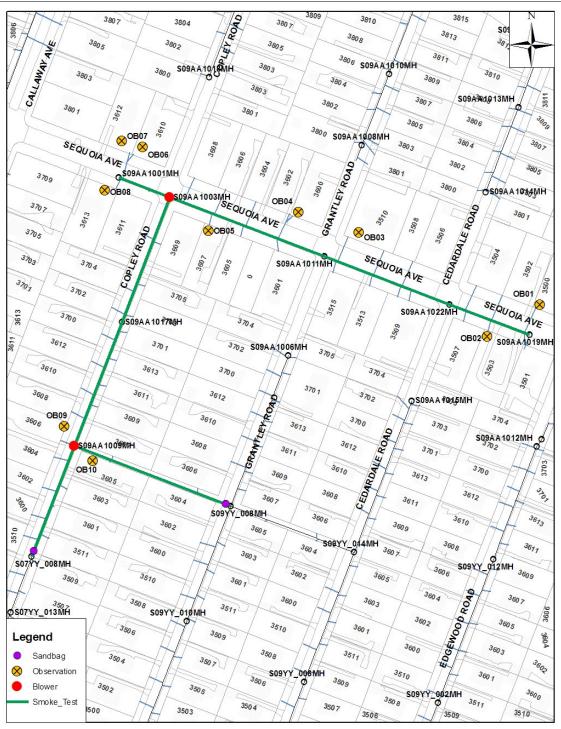

High Level Sewershed

Run Summary ————————————————————————————————————								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-009	Smoke	8/7/2008	ADS/TM	S09AA1003MH	Dry	Yes	2,090.72	

Isolated Pipes Pipe ID **Upstream MH** Downstream MH S09AA1001G1 S09AA1001MH S09AA1003MH S09AA1011G1 S09AA1011MH S09AA1003MH S09AA1019G1 S09AA1019MH S09AA1022MH S09AA1009G1 S09AA1009MH S09YY_008MH

S09AA1003G1	S09AA1003MH	S09AA1017MH	281.8924	8
S09AA1017G1	S09AA1017MH	S09AA1009MH	279.5359	8
S09AA1022G1	S09AA1022MH	S09AA1011MH	282.5810	8
S07YY_008G1	S07YY_008MH	S09AA1009MH	249.8214	8

Observations & Photos

Obs_ID S1028-009-OB01 **Address** 3500 Sequoia Ave

StatusPrivateSourceCleanout

Location Yard - front **Nearest MH** S09AA1019MH

Comments Smoke from cleanout in front yard. 3500



Picture \S1028-009-OB01-P01.jpg

Comments Front of house, 3500 Sequoia

Ave.

Obs_ID S1028-009-OB02 **Address** 3503 Sequoia Ave

Length

(ft)

116.121

347.9513

179.9872

352.8305

Diameter

(ln)

8

8

8

8

 Status
 Private

 Source
 Downspout

 Location
 Yard - front

 Nearest MH
 S09AA1022MH

Comments Smoke from downspout near front porch of

house. 3503 Sequoia Ave.



Picture \S1028-009-OB02-P01.jpg

Comments Front of house, 3503 Sequoia

Ave.

High Level Sewershed

Run	Summary
-----	---------

The summary								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-009	Smoke	8/7/2008	ADS/TM	S09AA1003MH	Dry	Yes	2,090.72	_

Obs_ID S1028-009-OB03
Address 3510 Sequoia Ave
Status Private
Source Cleanout
Location Yard - front
Nearest MH S09AA1011MH

Comments Smoke from cleanout in front yard. 3510

Sequoia Ave.



Picture \S1028-009-OB03-P01.jpg

Comments Front of house, 3510 Sequoia

Ave.

Obs_ID S1028-009-OB05 **Address** 3607 Sequoia Ave

Status Private
Source Cleanout

Location Paved concrete **Nearest MH** S09AA1003MH

Comments Smoke from cleanout in front walkway. 3607

Sequoia Ave.



Picture \S1028-009-OB05-P01.jpg

Comments Front of house, 3607 Sequoia

Ave.

Obs_ID S1028-009-OB04 **Address** 3600 Sequoia Ave

Status Private
Source Cleanout

Location Yard - front **Nearest MH** S09AA1011MH

Comments Smoke from cleanout in front yard. 3600

Seguoia Ave.



Picture \S1028-009-OB04-P01.jpg

Comments Front of house, 3600 Sequoia

Ave.

Obs_ID S1028-009-OB06 **Address** 3610 Seguoia Ave

Status Private **Source** Cleanout

Location Yard - front **Nearest MH** S09AA1003MH

Comments Smoke from cleanout in front yard. 3610

Sequoia Ave.



Picture \S1028-009-OB06-P01.jpg

Comments Front of house, 3610 Sequoia

Ave.



High Level Sewershed

Run	Summary
-----	----------------

Date			. Company /		Ground	Notification	Total
Test ID	Test Type	Inspected	Super.	Blower MH	Condition	Made?	Length
S1028-009	Smoke	8/7/2008	ADS/TM	S09AA1003MH	Dry	Yes	2,090.72

Obs_ID S1028-009-OB07
Address 3612 Sequoia Ave
Status Private
Source Cleanout
Location Yard - front
Nearest MH S09AA1001MH

Comments Smoke from cleanout in front yard. 3612

Sequoia Ave.



Picture \S1028-009-OB07-P01.jpg

Comments Front of house, 3612 Sequoia

Ave.

Obs_ID S1028-009-OB09 **Address** 3606 Copley Road

Status Public
Source Catch Basin
Location Curb

Nearest MH S09AA1009MH

Comments Smoke from catch basin along curb. 3606

Copley Rd.



Picture \S1028-009-OB09-P01.jpg

Comments Front of house 3606 Copley Rd.

Obs_ID S1028-009-OB08 **Address** 3613 Sequoia Ave

Status Public

Source Service Lateral

Location Yard - front

Nearest MH S09AA1001MH

Comments Smoke from service lateral near public

sidewalk. 3613 Sequoia Ave.



Picture \S1028-009-OB08-P01.jpg

Comments Front of house, 3613 Sequoia

Ave.

Obs_ID S1028-009-OB10 **Address** 3605 Copley Road

Status Private **Source** Cleanout

Location Yard - side **Nearest MH** S09AA1009MH

Comments Smoke from cleanout in side yard. 3605

Copley Rd.



Picture \S1028-009-OB10-P01.jpg

Comments Side of house, 3605 Copley Rd.

